
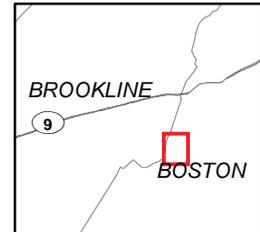


# Spring Pond

Jamaicaway, Boston, MA  
 Inspection Date: 09/05/2013

Dry weather flow was investigated in manhole 37205 on Jamaicaaway in Boston. A trickle from a 12" clay pipe that runs underneath the property at 242 Jamaicaaway was observed as well as a more significant flow from an 18" cast iron pipe appearing to originate from the direction of Castleton Street. Further investigation of two manholes on Castleton Street found that the manholes had been sealed under their metal covers with asphalt and were unable to be investigated. The sealed manholes are off of DCR property and were marked with "sewer" covers. Survey results indicated that one or both of the manholes located on Castleton Street may be contributing to the flow observed in manhole 37205 that then flows downstream to raised manhole 12956. This raised manhole has been outfitted with a hinged cover that overflows during some rain events and contributes to erosion and sedimentation issues around Spring Pond. The overflow was documented during a rain event four days before this IDDE survey through photos forwarded to DCR from Mass Fish and Wildlife. Test results performed on the flow from Castleton Street yielded results that indicate possible sanitary sewer contamination. A desktop review of video footage taken in this system displayed results consistent with the findings of this survey.

## IDD Test Results Manhole 37205:

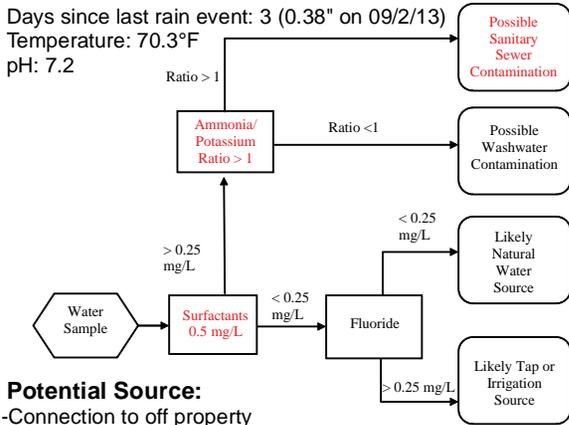

- Catchbasin
- Manhole
- ▲ Inlet
- ▲ Outlet
- Other
- Conveyance (Pipe)
- ⊗ Retention/Detention Feature
- DCR Parkway in Urban Area
- DCR Property in Urban Area
- - - Town Boundary

Note: Red features represent observed dry weather flow path

